

# 1960 Corvette: Service Bulletin: Generator Belt Misalignment

**Subject:** Generator Belt Misalignment  
**Model and Year:** 1960 Corvette  
**Source:** G.M. of Canada Service Bulletin  
**Bulletin No:** NA  
**Section:** NA  
**Date:** April 30, 1960

## GENERATOR BELT MISALIGNED DUE TO IMPROPER INSTALLATION OF GENERATOR BRACKET - 1960 Corvette Equipped With Fuel Injection

In the event difficulty is experienced with fan belt misalignment on fuel injection Corvettes only, check to see that the generator mounting bracket is assembled properly. When bracket is installed upside down, the generator is moved 1/4" too far forward. The bracket must be installed with the off-centre holes downward, as shown in Fig. 20.

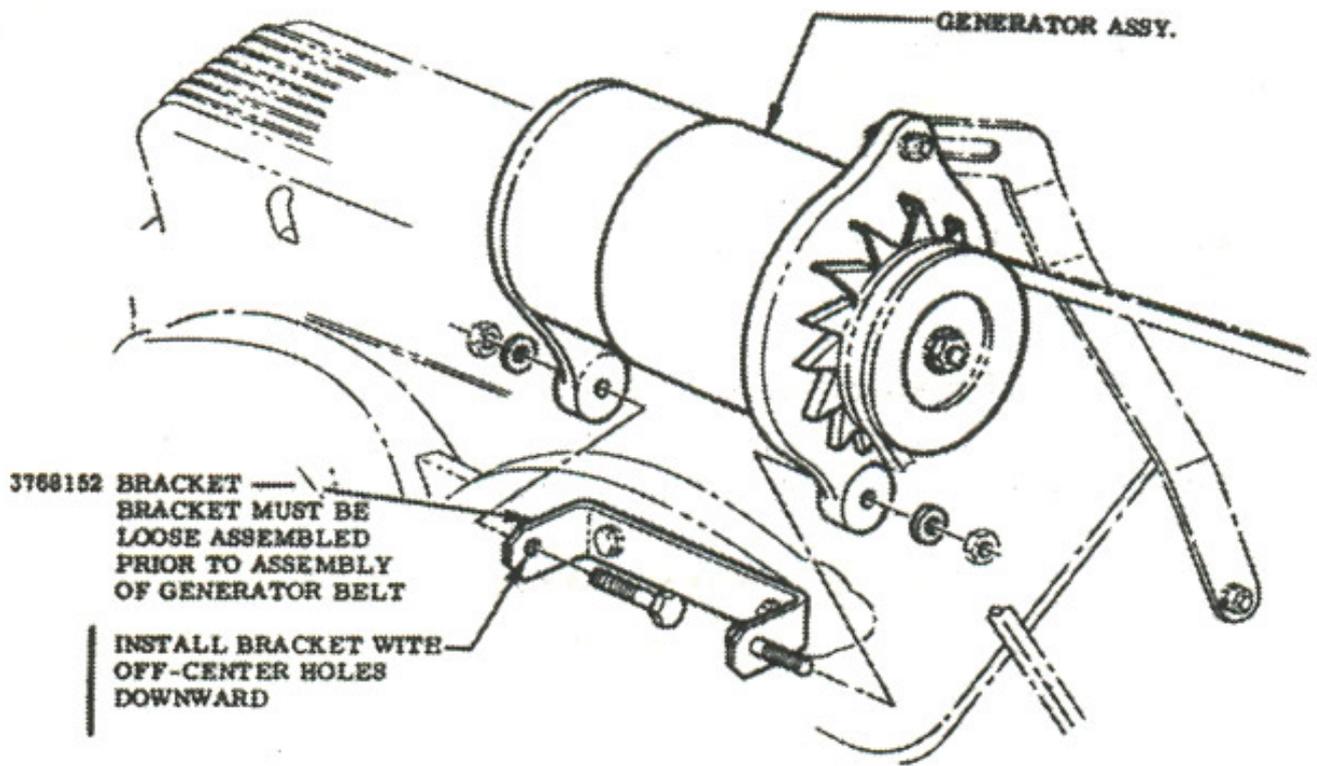


Fig. 20.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1960-corvette-service-bulletin-generator-belt-misalignment-1181.html>