

# 1978 - 1979 Corvette: Service Bulletin: Power Antenna Operation

**Subject:** Power Antenna Operation

**Model and Year:** 1978-79 Vehicles with CB or RPO U75

**Source:** Chevrolet Dealer Service Technical Bulletin

**Bulletin No:** 79-T-8

**Section:** XII

**Date:** April, 1979

**TO: ALL CHEVROLET DEALERS**

Extreme cold weather and/or excessive buildup of dirt/corrosion may cause a power antenna to stick and fail to extend or retract completely.

Complaint vehicles should be corrected as follows:

1. Thaw unit as required if problem occurred during extremely cold weather.
2. Extend mast. This may require manually assisting the mast when antenna unit is energized.
3. Clean mast sections thoroughly to remove any water or dirt. Note: It may be necessary to use fine steel wool to remove any corrosion residue that may exist.
4. Extend and retract antenna mast several times repeating steps 2 and 3 until mast stays clean and dry.
5. With mast fully extended (triband - 36" from fender surface, A<-FM - 33" from fender surface), lubricate entire surface of mast sections liberally, especially the section joints, with one of the following:
  - a. Spray silicone (Pen Ray or equivalent)
  - b. Liquid graphite (Lock Ease or equivalent)

6. Operate antenna up and down several times, then wipe off excess lubricant.

Time for correction: .2 hours.

Chevrolet Motor Division  
General Motors Corporation

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1978-1979-corvette-service-bulletin-power-antenna-operation-124.html>