

# 2017 Corvette: Service Bulletin: SES Lamp Setting A P0106 And/or P0506

## #PIP5423: SES Lamp Setting A P0106 And/or P0506 - (Oct 3, 2016)

Brand:	Model:	Model Year:	from	to	VIN:	from	to	Engine:	Transmi	ssion:
Cadillac Escalade		2015	2017		SOP	END		L86	All	
Cadillac CTS-V		2016	2017		SOP	END		Lt4	All	
Chevrolet Camaro	et	2016	2017		SOP	END		LT1	All	
Chevrolet Corvette	et	2017	2017		SOP	END		LT1, LT4	ALL	
Chevrolet Silverado	et	2014	2017		SOP	END		L83, L86,	ALL	
Chevrolet Suburban	et	2015	2017		SOP	END		LV3		
Chevrolet Tahoe	et	2015	2017		SOP	END		L83, L86	ALL	
GMC Sierra		2014	2017		SOP	END		L83, L86.	ALL	
GMC Yukon		2015	2017		SOP	END		LV3		
								L83, L86	ALL	

*Involved Region or Country*

North America and .....

*Additional RPO/s:*

N/A

*Condition*

A vehicle may have a concern of the SES lamp with a P0106 and P0506.

*Cause*

This maybe caused by a broken valve spring

**Correction**

Replace the broken valve spring if the valve did not drop and cause block damage

Service Procedure;

Remove the valve cover and inspect for a broken valve spring.

If a broken valve spring is found inspect the intake manifold for a collapsed runner.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2017-corvette-service-bulletin-ses-lamp-setting-a-p0106-and-or-p0506-1315.html>