

2020 - 2021 Corvette: Service Bulletin: #21-NA-131: Memory Seat Module Does Not Adjust - (Jun 2, 2021)

#21-NA-131: Memory Seat Module Does Not Adjust - (Jun 2, 2021)

Subject: Memory Seat Module Does Not Adjust

This bulletin replaces PIT5796A. Please discard all previous copies of PIT5796A.

Brand:	Model:	Model Year: from	to	VIN: from	to	Engine:	Transmi ssion:
Buick	Envisio n	2021	2021	—	—	—	—
Cadilla c	CT4	2020	2021				
	CT5						
	Escalad e	2021					
	Escalad e ESV						
Chevrol et	Corgett e	2020	2021				
	Suburba n	2021	2021				
	Tahoe						

GMC	Yukon	2021	2021
	Yukon		
	XL		

Involved Region or Country

North America

Condition

Some customers may comment on one or more of the following conditions:

- Auto Entry/Exit is intermittently or consistently inoperable.
- The seat may intermittently not recall or exit despite the personalized settings being set.
- Limited seat movement in one direction (specifically unable to move the recline axis).
- The driver seat back will not recline or the seat will not move to the full rearward or forward position.

A technician may find a Service Driver Assist message or Super Cruise drops out intermittently and the External Object Calculation Module (EOCM) sets a DTC against the Memory Seat Module (MSM).

- U0211 Lost Com

- U0512 Invalid data

Cause

The cause of the condition may be a software anomaly in the MSM.

Correction

Reprogram the Driver Seat Adjuster Memory Module.

Version

1

Modified

Released June 02, 2021

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2020-2021-corvette-service-bulletin-21-na-131-memory-seat-module-does-not-adjust-jun-2-2021-1516.html>