

2003 Corvette: Service Bulletin: Deck Lid Not Flush With Left Hand Quarter Panel (Install Struts, Replace Right Deck Lid Hinge)

Subject: Deck Lid Not Flush With Left Hand Quarter Panel (Install Struts, Replace Right Deck Lid Hinge)

Source: Chevrolet Dealer Technical Service Bulletin

Number: #03-08-66-001 - (01/13/2003)

Models: 2003 Chevrolet Corvette Convertible and Z06

Condition:

Some customers may comment that the deck lid is not flush with the left-hand quarter panel when it is closed.

Cause:

The single strut used on the left hand side of some 2003 models may cause the deck lid to not be flush with the quarter panel.

Correction:

Open the deck lid and inspect the right hinge for the ball stud provision that allows for installation of a strut. If the ball studs are missing, replace the right hinge with P/N 10426104, hinge assembly. Remove the single strut from the left side hinge. Install the struts, P/N 10278149, on the left and the right deck lid hinges. The replacement hinge and struts were used on 2002 models.

Parts Information:

| | | |
|--|--|--|
| | | |
|--|--|--|

| Part Number | Description | Qty |
|-------------|--|-----|
| 10278149 | Strut- Rear Compartment Lid | 2 |
| 10426104 | Hinge - Rear Compartment Lid RH Side | 1 |

© Copyright General Motors Corporation. All Rights Reserved.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2003-corvette-service-bulletin-deck-lid-not-flush-with-left-hand-quarter-panel-install-struts-replace-right-deck-lid-hinge-310.html>