

# 1999 - 2001 Corvette: Service Bulletin: Windnoise Around B-Pillar (Add Sealer)

**Source:** Chevrolet Dealer Service Bulletin

**Number:** 01-08-58-001

**Subject:** Windnoise Around B-Pillar (Add Sealer)

**Model Year:** 1999-2001 Corvette Hardtop


## **Condition**

Some owners may comment on windnoise around the B-pillar.

## **Cause**

The windnoise may be caused by a void in the sealer behind the B-pillar weatherstrip retainer.

## **Correction**

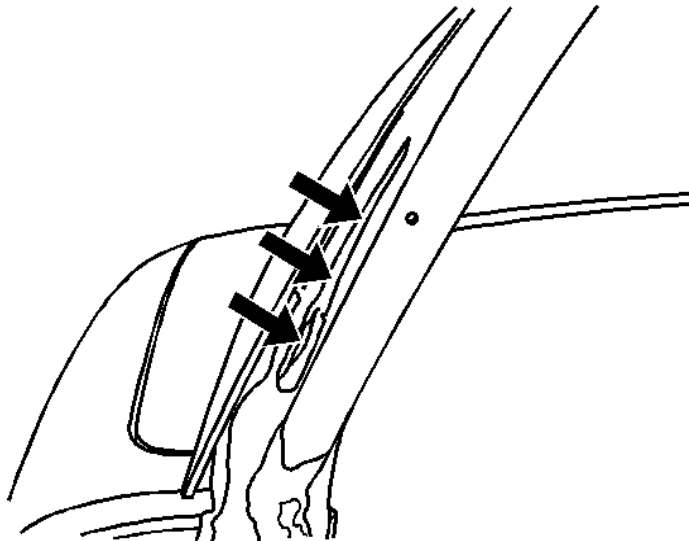

Remove the weatherstrip retainer and the B-pillar exterior molding. Seal the void with GM RTV Silicone Rubber Sealant-Black, P/N 12345739 (in Canada, use P/N 10953541).

## Parts Information

Part Number	Description
12345739 (U.S.)	GM RTV Silicone Rubber Sealant- Black
10953541 (Canada)	

Parts are currently available from GMSPPO.

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C1520	Retainer (RH), Weatherstrip Body Lock Pillar	0.4 hr
C1521	Retainer (LH), Weatherstrip Body Lock Pillar	0.4 hr

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved.**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1999-2001-corvette-service-bulletin-windnoise-around-b-pillar-add-sealer-311.html>