

# 2001 Corvette: Service Bulletin: Incomplete Brake Pedal Return

**Model Year:** 2001 Corvette

**Subject:** Incomplete Brake Pedal Return - (Replace Vacuum Brake Booster)

**Source:** Chevrolet Dealer Service Technical Bulletin

**Number:** 01-05-22-002

**Date:** April, 2001

## **Condition:**

Some owners may comment that after the brake pedal is released, the brakes appear to remain partially applied (light brake drag) and/or that the brake lights remain illuminated.

## **Cause:**

Condition may be due to vacuum brake boosters assembled with return springs that may exhibit inadequate force to completely return the brake pedal after a brake apply.

## **Correction:**

Replace the existing vacuum brake booster with a new booster, P/N 18046267, following the procedure contained in the applicable Service Manual.

## **Parts Information:**

Number: 18046267

Description: Vacuum Brake Booster

Parts are currently available from GMSPO.

## **Online URL:**

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2001-corvette-service-bulletin-incomplete-brake-pedal-return-449.html>