

1998 Corvette Convertible: Service Bulletin: Clicking Noise Coming From Folding Top

463 July 24, 2014 [Body and Trim](#) 0 709

Subject: CLICKING/TICK NOISE COMING FROM FOLDING TOP (INSTALL INSULATOR STRIP #2 AND #3 BOW)
Source: Chevrolet Dealer Technical Service Bulletin
Number: 83-15-04 - (04/08/1998)
Models: 1998 CHEVROLET CORVETTE CONVERTIBLE

Condition

SOME CUSTOMERS MAY COMMENT ON A CLICKING/TICK TYPE NOISE COMING FROM THE FOLDING TOP ABOVE THE DRIVER/PASSENGER’S HEAD AT CERTAIN HIGHWAY SPEEDS AND/OR WIND CONDITIONS.

Correction

INSTALL 3M(R) SCOTCHMATE HOOK AND LOOP FASTENING SYSTEM (P/N 06480) OR EQUIVALENT, TO THE UNDERSIDE OF #2 AND #3 BOWS. INSTALLING THE LOOP SIDE OF THIS FASTENING SYSTEM BETWEEN THE BOW AND HEADLINER RETAINER WILL ACT AS AN INSULATOR TO REPAIR THIS CONDITION.

IMPORTANT:

THIS PROCEDURE REQUIRES THE USE OF AN UPHOLSTERY TYPE OR AUTOMOTIVE TRIM STAPLER BY A TECHNICIAN KNOWLEDGEABLE IN WORKING WITH FOLDING TOP MATERIAL. IF YOU INTEND TO SUBLET VEHICLES REQUIRING THIS REPAIR TO AN INDEPENDENT AUTOMOTIVE TRIM SHOP, PLEASE SUPPLY THEM WITH A COPY OF THIS BULLETIN.

PROCEDURE:

1. REMOVE THE HEADLINER FOLLOWING THE PROCEDURES IN THE SERVICE MANUAL.
2. SEPARATE THE TWO HALVES OF THE 3M(R) SCOTCHMATE HOOK AND LOOP, OR EQUIVALENT. DISCARD THE HOOK/ROUGH SIDE OF THE STRIP. INSTALL THE LOOP/SOFT SIDE STRIP TO THE UNDERSIDE OF #2 AND #3 BOWS. PLACE EACH STRIP TO THE RIGHT AND LEFT OF CENTER OF THE BOW OVER THE HEADLINER ATTACHMENT HOLES.
3. REINSTALL THE HEADLINER FOLLOWING THE PROCEDURES IN THE SERVICE MANUAL. INSTALL THE HEADLINER RETAINER SCREWS THROUGH THE LOOP/SOFT SIDE STRIP INTO THE #2 BOW AND #3 BOW AND TIGHTEN ALL SCREWS TO 2 N.M (17 LB IN).

MATERIALS OBTAINED FROM LOCAL DISTRIBUTOR:

QTY.	MATERIAL	P/N	DESCRIPTION	NEEDED	ALLOWANCE
=====	=====	=====	=====	=====	=====
	#06480	3M(R)	SCOTCHMATE HOOK AND	4	\$8.48 12 PER BX LOOP FASTENING SYSTEM

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the

equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

© Copyright General Motors Corporation. All Rights Reserved

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1998-corvette-convertible-service-bulletin-clicking-noise-coming-from-folding-top-463.html>