

# 1990 - 1992 Corvette ZR-1: Service Bulletin: Engine Noise - Install Bushing

**Subject:** ENGINE NOISE-INSTALL BUSHING 5.7L V8 (RPO LT5)

**Model and Year:** 1990-92 CORVETTE WITH 5.7L ENGINE (RPO LT5)  
AND MANUAL TRANSMISSION

**Source:** Chevrolet Service Bulletin

**Bulletin Number:** 92-230-6 - (06/15/1992)

## **Condition:**

Some owners of 1990-92 Corvette ZR-1 may comment on a squeal noise that resembles a bearing noise. This noise may occur during clutch engagement from a standing stop. This noise can also occur during vehicle coast down with the clutch disengaged (clutch pedal depressed).

## **Cause:**

This noise is due to the input shaft of the transmission contacting the crankshaft bushing. The noise usually occurs during clutch engagement from a standing stop or vehicle coast down because of the speed difference between the engine and the transmission input shaft.

## **Correction:**

A revised crankshaft bushing is available to reduce the above condition. The revised bushing has grooves in the hole to reduce surface contact with the transmission input shaft.

Crankshaft Bushing P/N 10125896

Remove and install bushing per Service Manual.

## **Part Availability:**

Parts are currently available from GMSPO.

## **Warranty Information:**

Labor Operation: J1420 Use applicable labor time guide for labor hours.

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1990-1992-corvette-zr-1-service-bulletin-engine-noise-install-bushing-486.html>