

1984 - 1990 Corvette: Service Bulletin: Power Seat Inoperative and/or Blows Fuses

509 July 25, 2014 [Electrical and Ignition](#), [Interior Parts and Trim](#) 0 2019

Subject: POWER SEAT INOP/BLOWS FUSES REPAIR/REPLACE HARNESS

Model and Year: 1984-90 CORVETTE

Source: Chevrolet Service Bulletin

Bulletin Number: 90-412-10 - (03/18/1991)

Condition:


Power Seat (AQ9) inoperative and/or blows fuse.

Cause:

Seat Control Switch Wire Harness may be shorted at gearnut support bracket. (See Illustration) With seat cushion installed, harness contacts gearnut support bracket and may become shorted with weight of driver/passenger.

Correction:

Repair and/or replace harness as required. Using a section of rubber hose (gas line) about (4) inches long (split), cover harness as illustrated taping both ends.

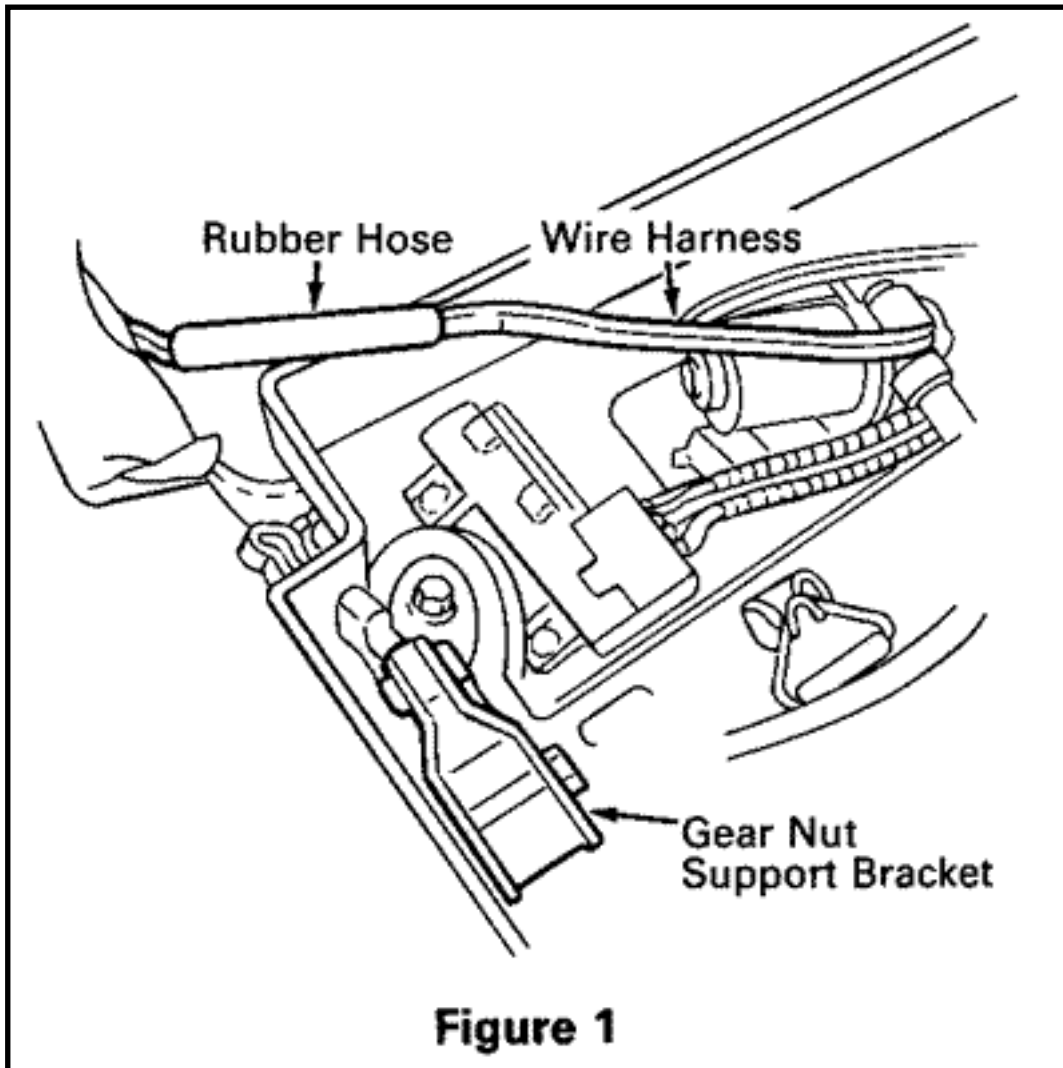

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

© Copyright General Motors Corporation. All Rights Reserved

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1984-1990-corvette-service-bulletin->

[power-seat-inoperative-and-or-blows-fuses-509.html](#)