

# 1992 - 1996 Corvette: Service Bulletin: Engine Miss/Poor Driveability Symptoms

**Subject:** Engine Miss/Poor Driveability Symptoms (Install Opti-Spark (ABITS) Distributor Assembly Service Kit)

**Model and Year:**

1994-96 Buick Roadmaster

1994-96 Cadillac Fleetwood

1992-96 Chevrolet Corvette

1993-97 Chevrolet Camaro

1994-96 Chevrolet Caprice

1993-97 Pontiac Firebird/Trans Am

with 4.3L or 5.7L Engines (VINs W, P, 5 -- RPOs L99, LT1, LT4)

**Source:** Chevrolet Dealer Service Bulletin

**Bulletin Number:** 87-65-27

THIS BULLETIN CANCELS AND SUPERSEDES DEALER SERVICE BULLETIN NO. 90-416-8E, DATED APRIL 1991. WARRANTY INFORMATION HAS BEEN ADDED. ALL COPIES OF 90-416-8E SHOULD BE DISCARDED.

**CONDITION:**

Some vehicles with the above engines and equipped with the Opti-Spark (ABITS) ignition system may exhibit an engine miss and/or poor driveability symptoms.

**CAUSE:**

The (ABITS) cap and the rotor may show carbon tracking, cracking, or water intrusion which can cause an engine miss and/or poor driveability symptoms.

**CORRECTION:**

Perform strategy-based diagnosis. If it is determined that the ABITS cap and/or rotor is the source of the concern, then a service kit may be now implemented instead of a complete ABITS assembly.

## PARTS INFORMATION:

There are two (2) variations of Opti-Spark Distributors. It will be mandatory to identify which type is to be serviced for proper parts procurement.

- The Opti-Spark Distributor II (Pin Drive -- WITH positive vent system) can be identified by the intake manifold vacuum hose connection (3), the air intake duct hose connection (4), or the non-splined pin drive (1). Refer to Figure 1.
- The Opti-Spark Distributor I (Splined Drive -- WITHOUT positive vent system) can be identified by the splined pin drive (1) or the lack of an intake air vacuum hose connection and an air intake duct hose connection. Refer to Figure 2.

Distributor	P/N	Application	Kit Contents
Opti-Spark I (Spline Drive) (No Vent)	10457735	92-94 Y	Distributor cap, rotor, screws, and washers
		93-94 F	
Opti-Spark II (Pin Drive) (Positive Vent)	10457293	94-96 B,D	Distributor cap, rotor, cover, screws and washers
		95-96 Y	
		95-97 F	

### Important

**It is necessary to use tool J 39997 (or the equivalent) for the distributor cap screws and tool J 39998 (or the equivalent) for the rotor screws.**

General Motors bulletins are intended for use by professional technicians, not

a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1992-1996-corvette-service-bulletin-engine-miss-poor-driveability-symptoms-555.html>