

# 1995 - 1996 Corvette: Service Bulletin: Delayed Engagement (Replace Pump Cover Assembly)

**Subject:** Delayed Engagement (Replace Pump Cover Assembly)

**Model and Year:**

1995-96 BUICK ROADMASTER

1995-96 CADILLAC FLEETWOOD

1995-96 CHEVROLET CAPRICE, CAMARO, CORVETTE

1995-96 HOLDEN COMMODORE (VR AND VS)

1995-96 PONTIAC FIREBIRD

1995-96 CHEVROLET AND GMC C/K, M/L, S/T, G MODELS

1996 OLDSMOBILE BRAVADA WITH HYDRA-MATIC 4L60-E (RPO M30)

**Source:** Chevrolet Dealer Service Bulletin

**Bulletin Number:** 67-71-48

**\*\*IMPORTANT: CANADIAN DEALERS SHOULD REPAIR TRANSMISSIONS FOLLOWING ESTABLISHED REPAIR PRACTICES.**

## **CONDITION:**

(FIGURES 1 AND 2) SOME OWNERS OF THE ABOVE MODELS, WITH A HYDRA-MATIC 4L60-E TRANSMISSION (BUILT BEFORE APRIL 29, 1996/JULIAN DATE 6120), MAY EXPERIENCE SOME DELAYED ENGAGEMENT WHEN VEHICLE IS NOT USED FOR MORE THAN 48 HOURS.

## **CAUSE:**

TORQUE CONVERTER FLUID LEVEL LOW DUE TO FLUID DRAIN DOWN.

## **CORRECTION:**

(FIGURE 3) REPLACE PUMP COVER ASSEMBLY WITH THE NEW TCC SIGNAL VALVE ASSEMBLY.

## **SERVICE PARTS INFORMATION**

NEW PART TRANSMISSION NUMBER DESCRIPTION MODELS -----  
----- 24209049 PACKAGE-COVER ASSEMBLY, PUMP ALL 1995-96  
MODELS EXCEPT THOSE LISTED BELOW.


24209050 PACKAGE-COVER ASSEMBLY, PUMP  
5BWD,5FFD,5YDD,6CCD,6CFD, 6KBD,6CHD,6CJD,6KCD,6BWD,  
6FFD,6YDD,6WBD,6WHD



PARTS ARE EXPECTED TO BE AVAILABLE ON JULY 1, 1996 FROM GMSPO.

FIGURE 1. - HYDRA-MATIC 4L60-E TRANSMISSION IDENTIFICATION INFORMATION

FIGURE 2. - HYDRA-MATIC 4L60-E TRANSMISSION IDENTIFICATION INFORMATION FOR TWO-PIECE CASE

FIGURE 3. - TORQUE CONVERTER CLUTCH SIGNAL VALVE ASSEMBLY LOCATION

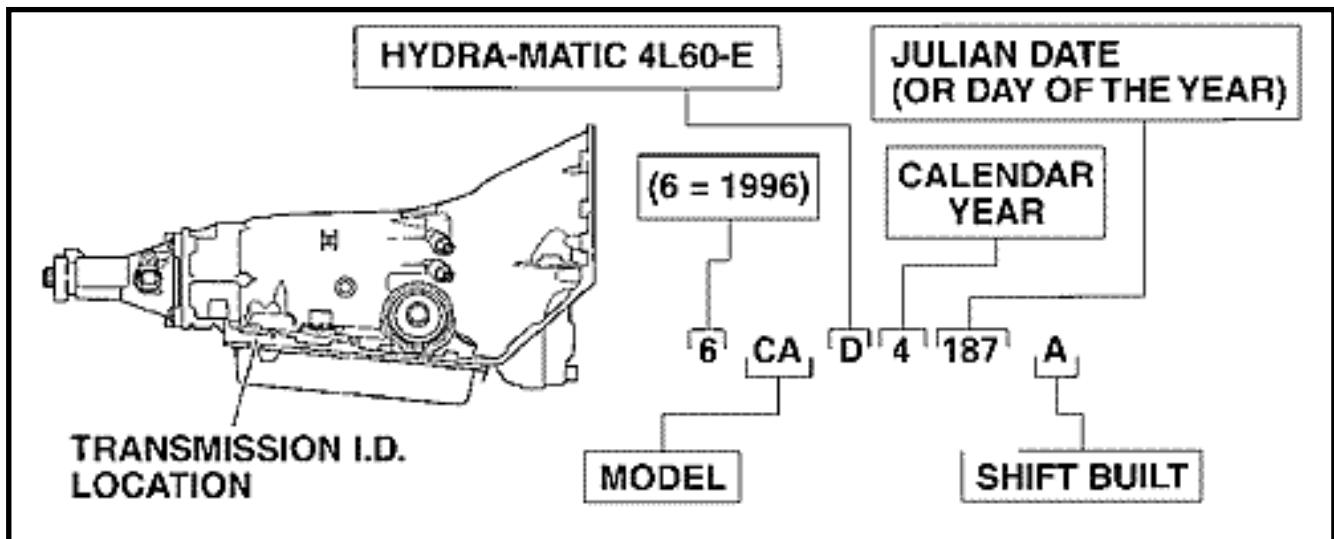

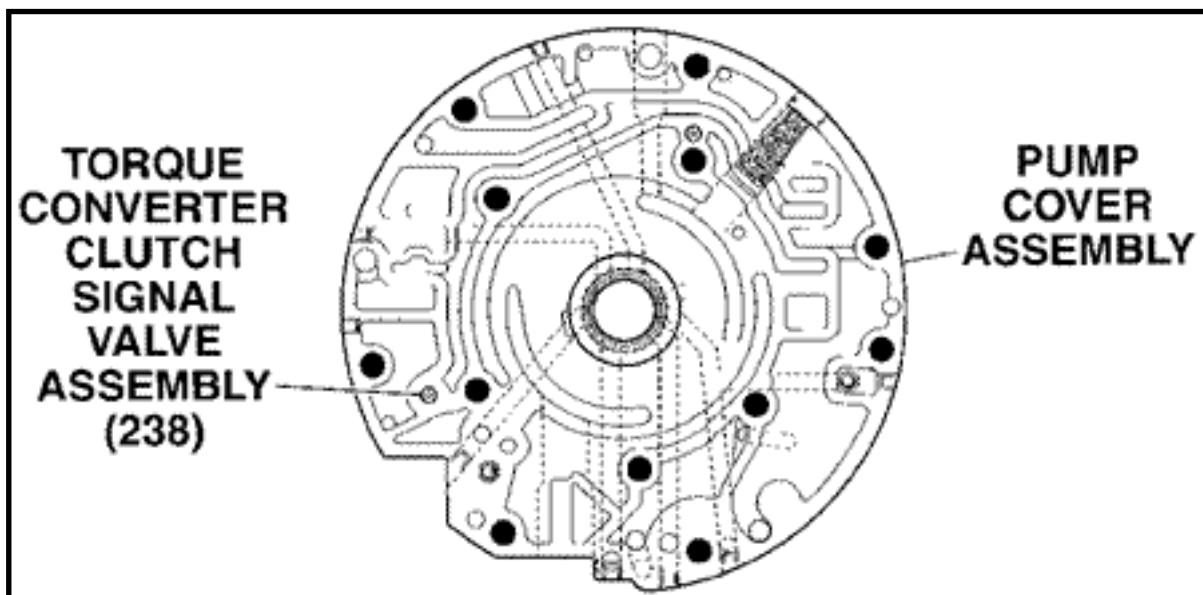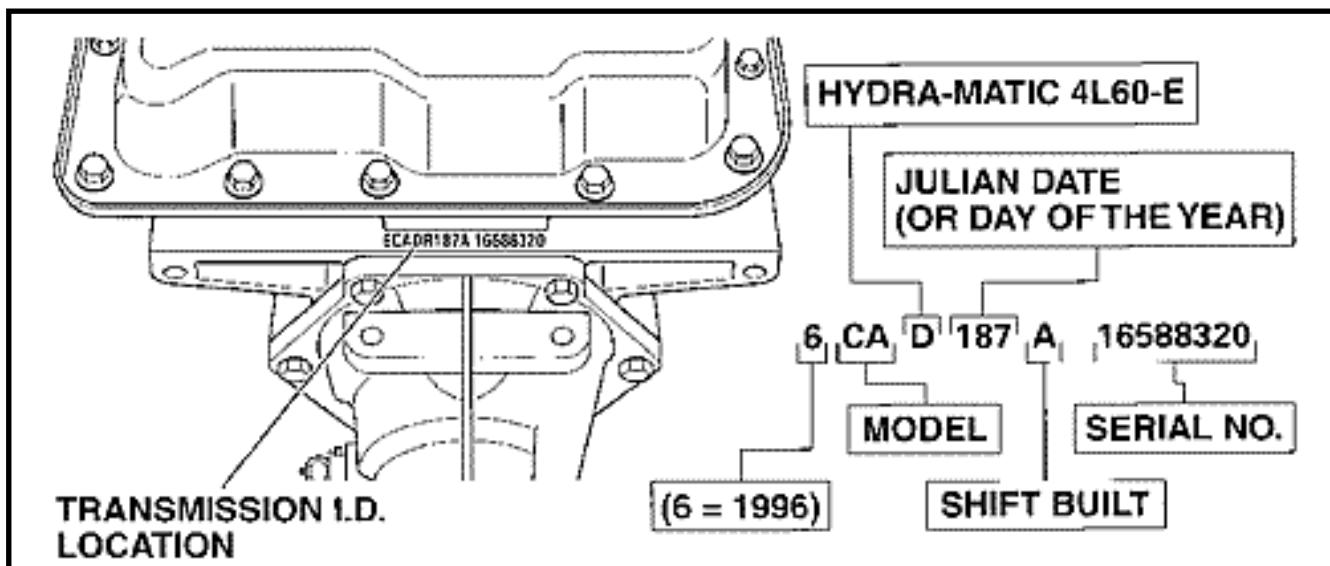

General Motors bulletins are intended for use by professional technicians, not a "do-it-yourselfer". They are written to inform those technicians of

conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1995-1996-corvette-service-bulletin-delayed-engagement-replace-pump-cover-assembly-594.html>