

1968 Corvette: Service Bulletin: Lubrication of Window Regulator Shaft

Model Year: 1968

Subject: LUBRICATION OF WINDOW REGULATOR SHAFT - 1968 CORVETTE

Source: Chevrolet Dealer Service Technical Bulletin

Number: 68-T-15

Section: I

Date: Jan. 10, 1968

To: ALL CHEVROLET DEALERS

Difficulty in raising and lowering the door windows may be experienced on some 1968 Corvettes built prior to 10-31-67. This condition is caused by lack of lubrication between the regulator shaft and the regulator hosing (see 1968 Chassis Service Manual, Page 1B-21, Figure 35, Item 6). Galling and metal pick-up on the shaft, due to lack of lube, results in a binding condition of the window regulator assembly.

If the above condition is encountered, inspect both door regulators assembly for proper lubrication. In most cases, the housing should be replaced; however, if galling or metal pick-up on the shaft is slight, the shaft can be repaired by polishing with Crocus Cloth and applying a thin coat of Lubriplate (Part No. 1050109 or Par No. 1050110), or equivalent, for proper lubrication.

PARTS AND LABOR DATA

	QUA.	PART NO.	PART DESCRIPTION	P	FC	L	T	OPERATION NO.	TIME
1.	1	3921583	Housing - L.H.		52	X		01426190	1.5
2.	1	3921580	Shaft						
3.	1	3921584	Housing - R.H.		52	X		01426090	1.5
4.	1	3921580	Shaft						

Online URL: <https://www.corvetteactioncenter.com/tech/knowledgebase/article.php?id=719>