

1961 Corvette: Service Bulletin: Corvette Grille Vibration

Subject: Corvette Grille Vibration

Model Year: 1961 Corvette

Source: Chevrolet Service and Mechanical Department - Product Engineering -
Technical Information - 1961 Product Data Book

Bulletin No: Page 1, Section XIII, Group 2

Date: February 2, 1961



TECHNICAL INFORMATION




SUBJECT

Corvette Grille
Vibration - 1961
Models

INFORMATION

A shrill whistling noise on early production Corvette Models at speeds of 40-60 MPH may be caused by grille vibration. The condition can be minimized by wedging four (4) one inch long pieces of one inch I.D. heater hose between the grille and front end sheet metal as illustrated.

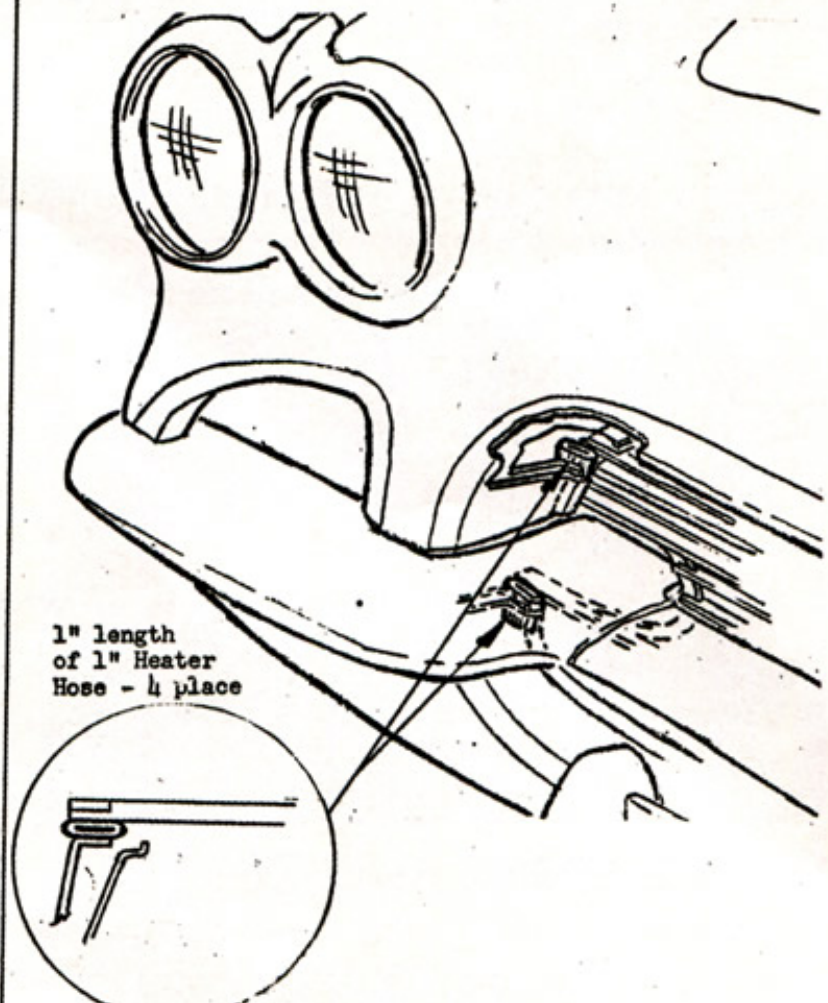

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1961-corvette-service-bulletin-corvette-grille-vibration-890.html>