

1968 Corvette: Service Bulletin: Gas Line Rattle

Subject: Gas Line Rattle

Model and Year: 1968 Corvette

Source: Chevrolet Dealer Service Information Bulletin - General Motors Canada

Bulletin No: 68-IC-54

Section: Chevrolet

Date: June 29, 1968

TO: ALL CHEVROLET DEALERS

A rattling or "ticking" noise from the rear of the vehicle has been experienced on some 1968 Corvettes. This noise is resulting from the fuel supply line vibrating against the return line. Production has corrected this condition by installing an additional clip in the existing frame hole at this location. Refer to Fig. 1. This same correction is recommended for units in the Field that are experiencing the rattling or "ticking" noise. Fig. 1 illustrates where the clip should be added and gives the related parts data.

Product Service Department,
General Motors Products of Canada, Limited

*ATTACH CLIP (3923695) WITH SCREW
442751 TO EXISTING HOLE IN FRAME

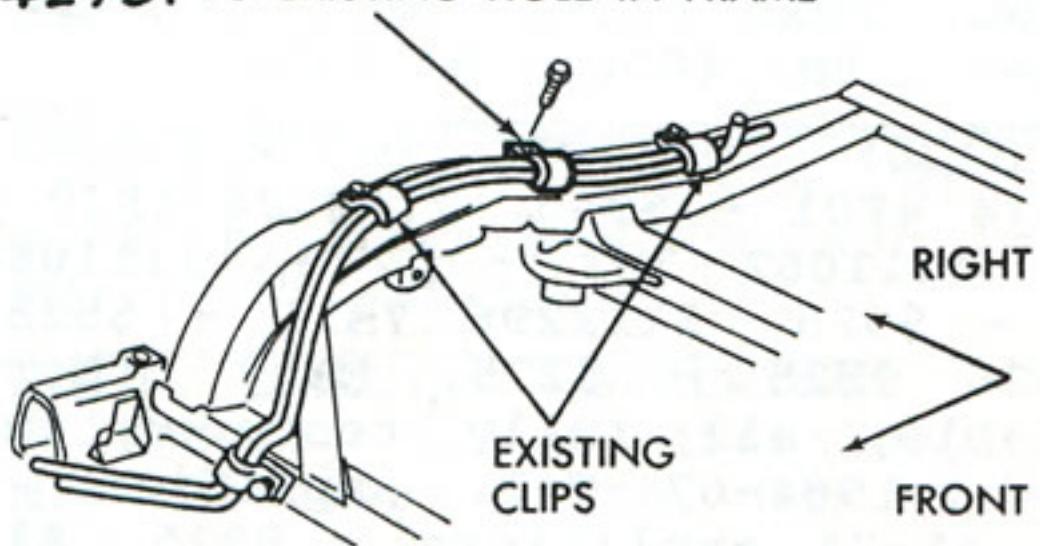


Fig. 1.

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1968-corvette-service-bulletin-gas-line-rattle-981.html>