

1990 Corvette: Service Bulletin: SIR Revised Code 42 Chart



Source: Chevrolet Dealer Service Bulletin

Number: 90-229-9

Subject: Service Manual Update - SIR Revised Code 42 Chart

Model Year: 1990 Y Car


This bulletin serves to revise the Code 42 Chart on page 9J-A-43 in Section 9J-A "Supplemental Inflatable Restraint" in the 1990 "Y" Service Manual.

The blue connector referenced in the chart, step 3, should be a brown connector.

Revised art is attached.

CODE 42 INDICATOR LAMP CIRCUIT (OPEN CIRCUIT)

NOTE: IF IGNITION IS TURNED "ON," WHEN CLUSTER FUSE IS REMOVED OR BLOWN, THIS CODE WILL SET. ALSO, AN INTERMITTENT OPEN IN THE "INFL REST" INDICATOR CIRCUIT OR A DISCONNECTED DIC CONNECTOR WILL SET THIS CODE.

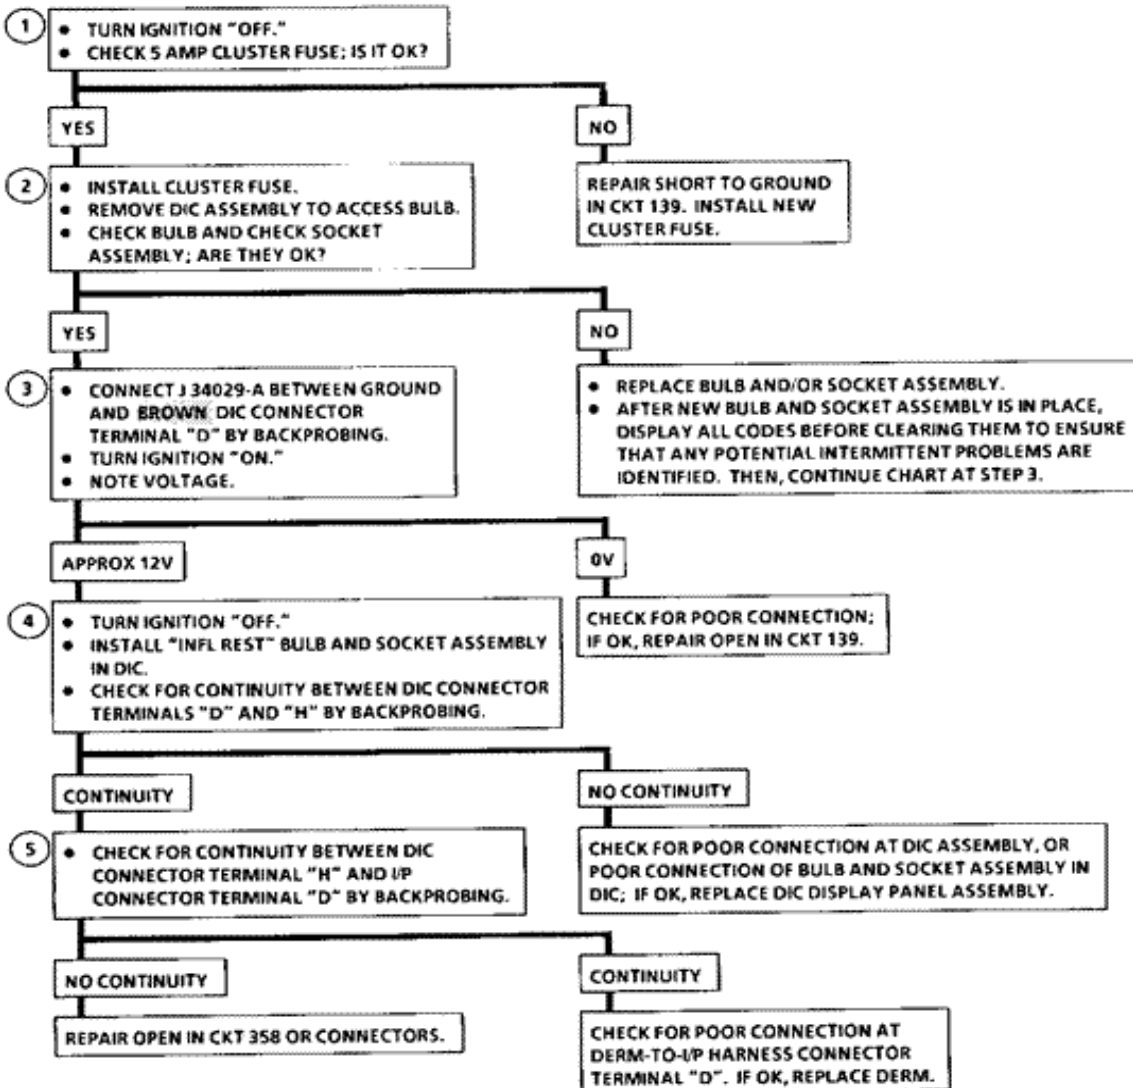

IMPORTANT

WHEN ALL DIAGNOSIS AND REPAIRS ARE COMPLETED, CLEAR CODES AND PERFORM "SIR DIAGNOSTIC SYSTEM CHECK" IN THIS SECTION.

4-4-90
95 6646-9J

a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

© Copyright General Motors Corporation. All Rights Reserved

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1990-corvette-service-bulletin-sir-revised-code-42-chart-502.html>