

# 1990 Corvette: Service Bulletin: SIR Revised Code 42 Chart

**Source:** Chevrolet Dealer Service Bulletin

**Number:** 90-229-9

**Subject:** Service Manual Update - SIR Revised Code 42 Chart

**Model Year:** 1990 Y Car

This bulletin serves to revise the Code 42 Chart on page 9J-A-43 in Section 9J-A "Supplemental Inflatable Restraint" in the 1990 "Y" Service Manual.


The blue connector referenced in the chart, step 3, should be a brown connector.

Revised art is attached.

## CODE 42

### INDICATOR LAMP CIRCUIT (OPEN CIRCUIT)

NOTE: IF IGNITION IS TURNED "ON," WHEN CLUSTER FUSE IS REMOVED OR BLOWN, THIS CODE WILL SET. ALSO, AN INTERMITTENT OPEN IN THE "INFL REST" INDICATOR CIRCUIT OR A DISCONNECTED DIC CONNECTOR WILL SET THIS CODE.

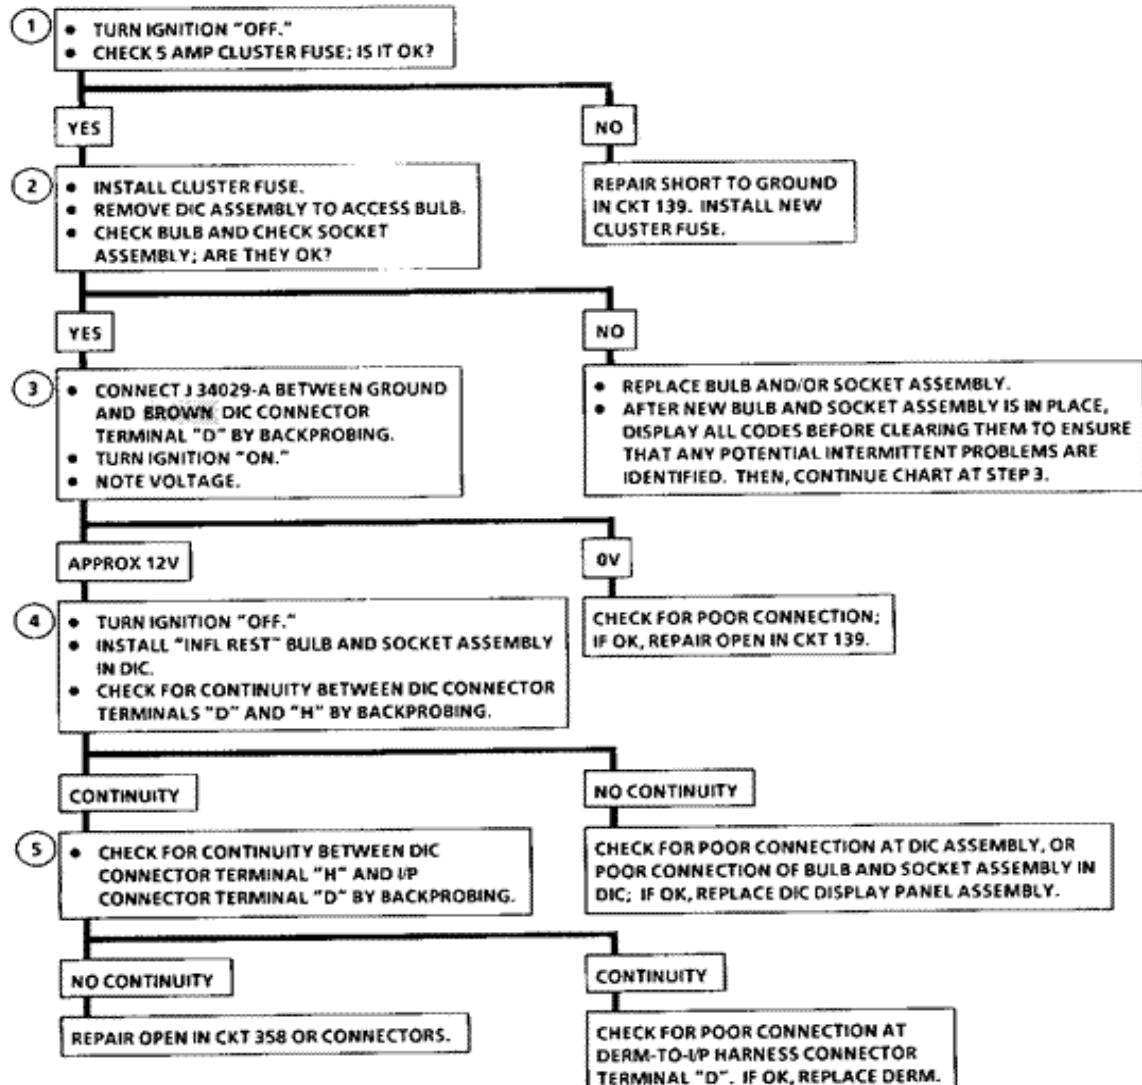

#### IMPORTANT

WHEN ALL DIAGNOSIS AND REPAIRS ARE COMPLETED, CLEAR CODES AND PERFORM "SIR DIAGNOSTIC SYSTEM CHECK" IN THIS SECTION.

4-4-90  
95 6646-93

90-229-9

General Motors bulletins are intended for use by professional technicians, not

a "do-it-yourselfer". They are written to inform those technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See a General Motors dealer servicing your brand of General Motors vehicle for information on whether your vehicle may benefit from the information.

**© Copyright General Motors Corporation. All Rights Reserved**

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1990-corvette-service-bulletin-sir-revised-code-42-chart-502.html>