

# 1961 Corvette: Service Bulletin: Corvette Grille Vibration

---

**Subject:** Corvette Grille Vibration

**Model Year:** 1961 Corvette

**Source:** Chevrolet Service and Mechanical Department - Product Engineering -  
Technical Information - 1961 Product Data Book

**Bulletin No:** Page 1, Section XIII, Group 2

**Date:** February 2, 1961



## TECHNICAL INFORMATION




## SUBJECT

Corvette Grille  
Vibration - 1961  
Models

## INFORMATION

A shrill whistling noise on early production Corvette Models at speeds of 40-60 MPH may be caused by grille vibration. The condition can be minimized by wedging four (4) one inch long pieces of one inch I.D. heater hose between the grille and front end sheet metal as illustrated.

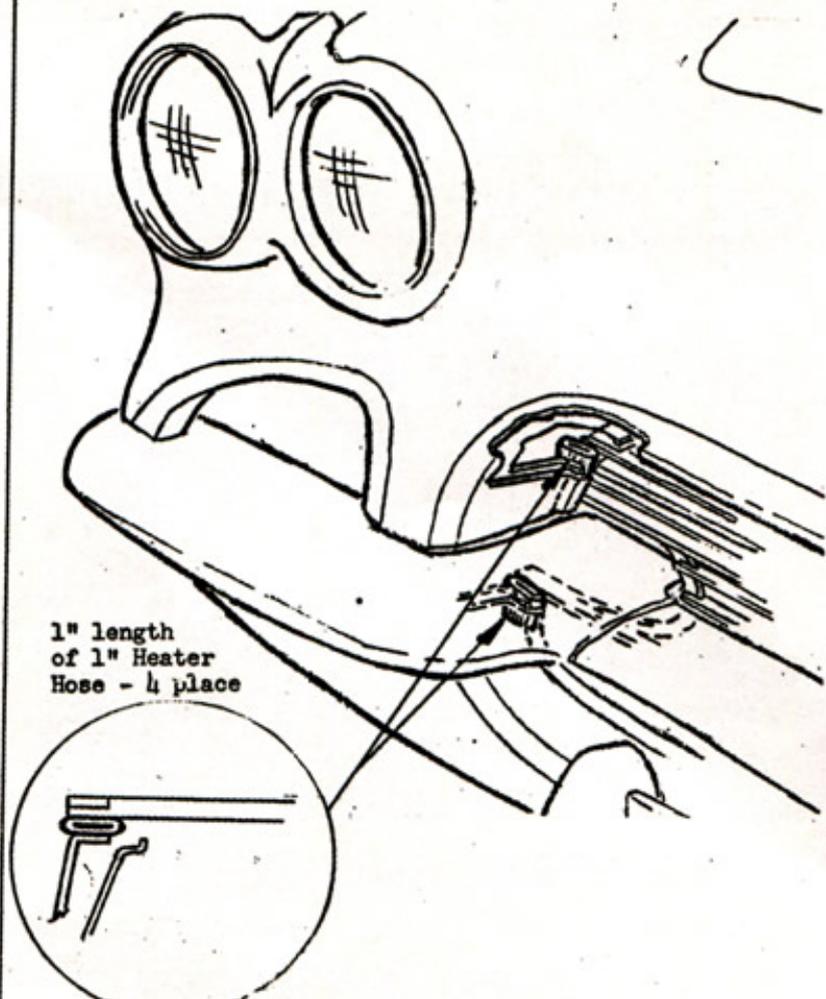

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1961-corvette-service-bulletin-corvette-grille-vibration-890.html>