1986 - 1987 Corvette: Service Bulletin: Clutch Master Cylinder Push Rod Bushing

Subject: Clutch Master Cylinder Push Rod Bushing
Model Year: 1986 - 1987 Corvette with Manual Transmission
Source: Chevrolet Dealer Service Bulletin
Bulletin No: 87-114, Section 7C
Date: April, 1987

TO: ALL CHEVROLET DEALERS

Some 1986 or 1987 Corvettes with manual transmissions may experience inadequate retention of the clutch master cylinder push rod attachment.

If the condition exists, remove the plastic bushing from the master cylinder push rod and replace with the following service parts. (Refer to Figure 1):

DESCRIPTION	PART NUMBER
Bushing	14080233
Flat Washer	120395
Retainer	148149

Use applicable Labor Time and Operation Number.

Chevrolet Motor Division
General Motors Corporation

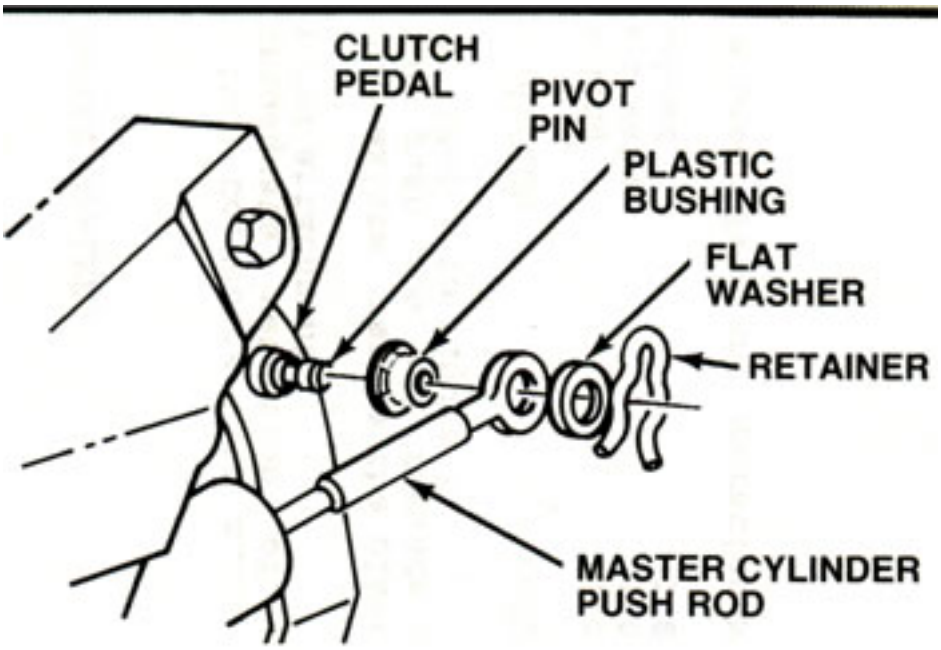

Online URL:
https://www.corvetteactioncenter.com/tech/knowledgebase/article/1986-1987-corvette-service-bulletin-clutch-master-cylinder-push-rod-bushing-904.html