

# 1957 - 1962 Corvette: Chevrolet Advance Information: New Clutch Pressure Plate Released for 1962 Corvette

**Subject:** New Clutch Pressure Plate Released for 1962 Corvette

**Model and Year:** 1957 - 1962 Corvette

**Source:** Chevrolet Advance Information Letter - Central Office

**Bulletin No:** A.I. #62-3

**Date:** November 28, 1961

Due to the increased frequency of clutch failures on 1961 High-Performance Corvettes, Engineering has released a new clutch pressure plate made of pearlitic malleable iron in place of the previously used grey cast iron. This new material will provide improved resistance to failure at high RPM's for all mechanical tappet equipped 1962 Corvettes.

The pearlitic malleable iron pressure plate may be identified by a cast depression in each driving lug as shown in Figure 1.

The new pressure plate and the clutch cover-pressure plate assembly are interchangeable with past models from 1957-61. They will be used for service replacement on all 1961 High Performance (RPO 354 and 468) Corvettes as soon as parts are available, and will eventually service all 1957-61 models when present stock of 1961 material is exhausted.


PARTS DATA

<u>Part Number</u>	<u>Service Usage</u>	<u>Description</u>
3816144	1961 Corvette Hi-Perf. 1962 Corvette - All	Clutch Cover - Pressure Plate Assembly
3815374	Same as Above	Pressure Plate

Extra copies are being forwarded to the Regional Service Engineers for release to Zone Service Managers to enable Zones to handle individually with dealers as required.

*H. A. Bangsberg*  
H. A. Bangsberg  
Technical Service Department

TRP:jg  
cc: Regional Service Managers  
Field Service Engineers  
Regional Service Engineers (10)

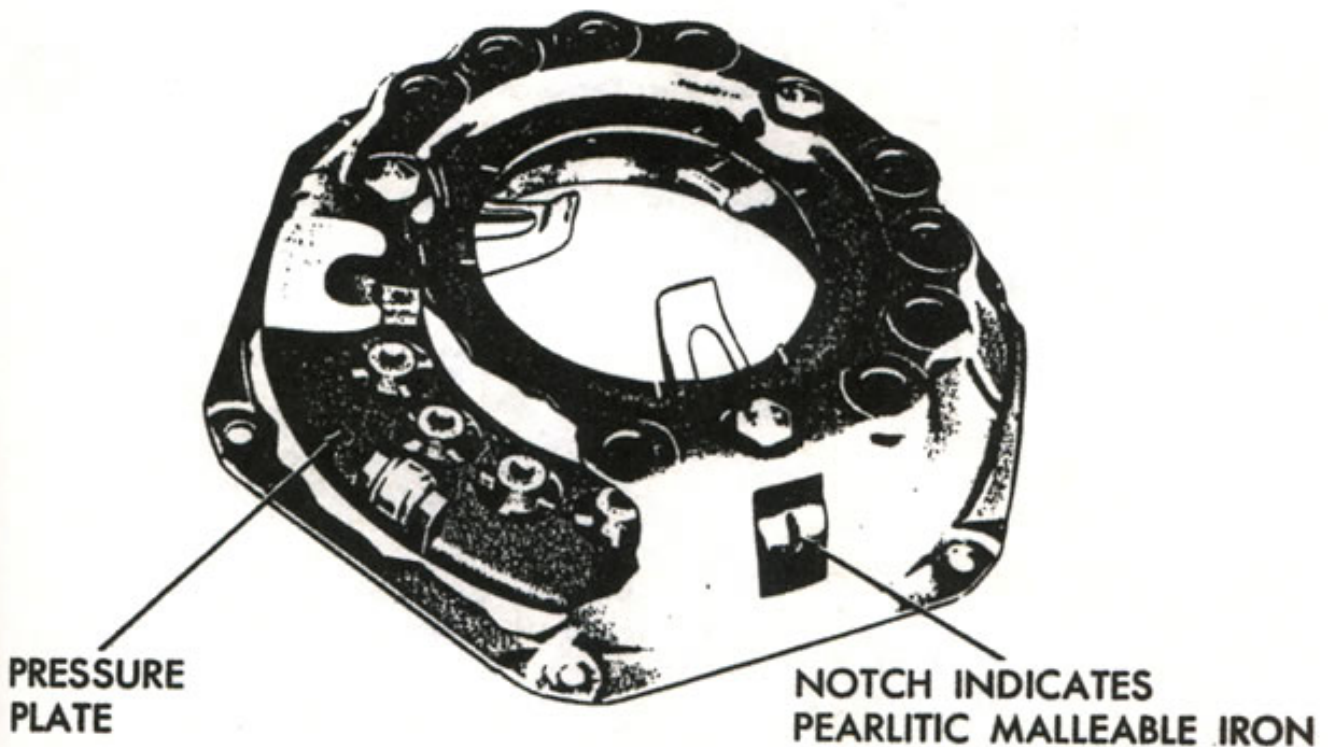

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1957-1962-corvette-chevrolet-advance-information-new-clutch-pressure-plate-released-for-1962-corvette-1044.html>

