

## 2017 Corvette Z06: Service Bulletin: #PIP5492: Scraping or Moan Noise heard During Engine Idle


### #PIP5492: Scraping or Moan Noise heard During Engine Idle - (Apr 10, 2017)

<b>Subject:</b>				Scraping or Moan Noise heard During Engine Idle			
Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CTS-V	2017		H0194673	H0196684	6.2L LT4	All
Chevrolet	Camaro	2017		H0197262	H0196702	6.2L LT4	All
Chevrolet	Camaro	2018		J0100002	J0100018	6.2L LT4	All
Chevrolet	Corvette	2017		H5605159	H5605593	6.2L LT4	All

<i>Involved Region or Country</i>	North America
<i>Additional RPO/s:</i>	ZL1, LT4
<i>Condition</i>	Customers may comment on a Scraping or Moan Noise heard best when the engine is idling
<i>Cause</i>	Supercharger Idler Pulley Assembly

## Correction

If the vehicle falls into the VIN's listed above Replace Idler pulley Assembly – P/N 12668046

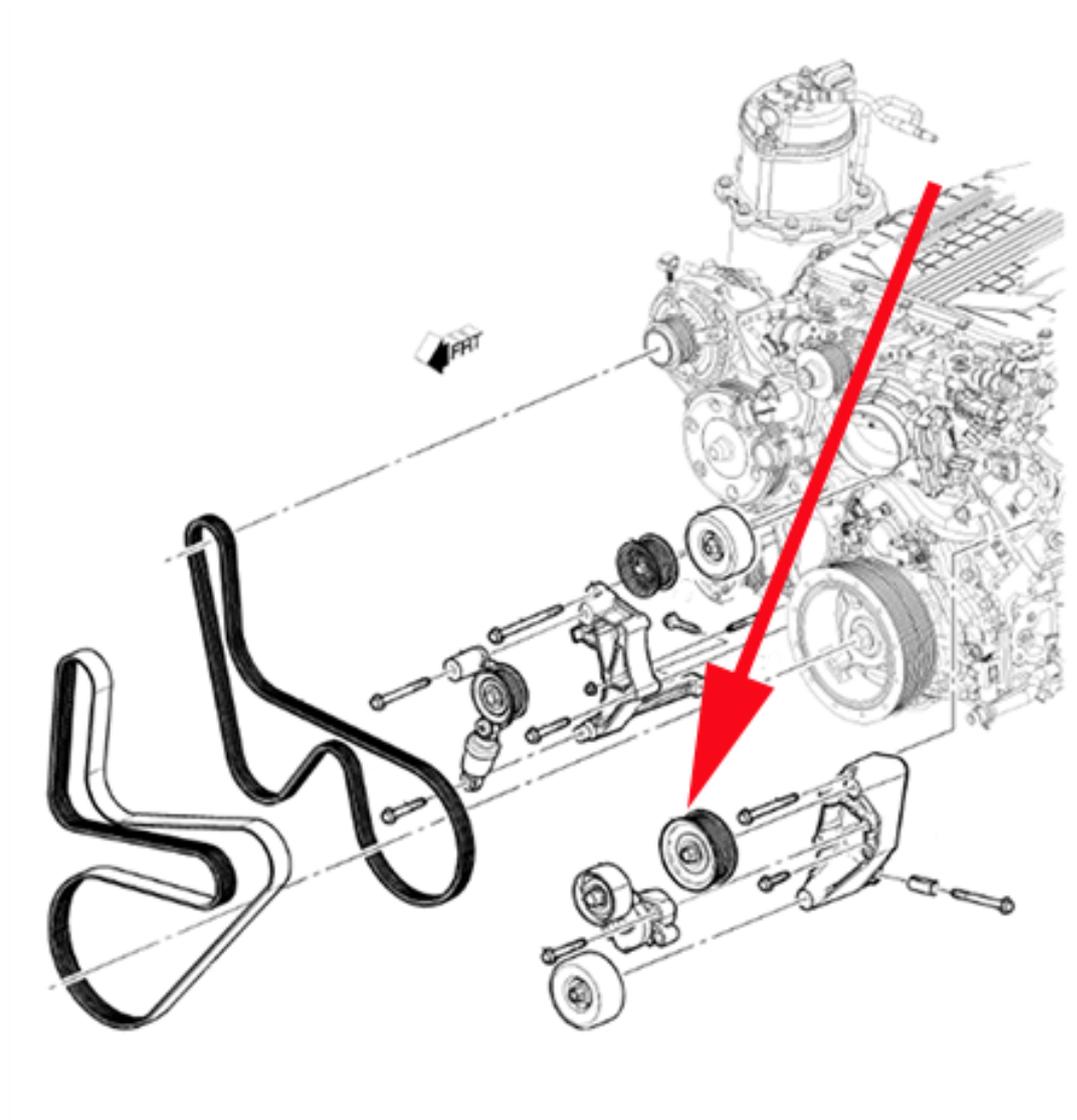

## Parts Information

Description	Part Number	Qty
Idler Assembly	12668046	1

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/2017-corvette-z06-service-bulletin-pip5492-scrapping-or-moan-noise-heard-during-engine-idle-1356.html>