

# 1986 - 1987 Corvette: Service Bulletin: Clutch Master Cylinder Push Rod Bushing

**Subject:** Clutch Master Cylinder Push Rod Bushing  
**Model Year:** 1986 - 1987 Corvette with Manual Transmission  
**Source:** Chevrolet Dealer Service Bulletin  
**Bulletin No:** 87-114, Section 7C  
**Date:** April, 1987

**TO: ALL CHEVROLET DEALERS**


Some 1986 or 1987 Corvettes with manual transmissions may experience inadequate retention of the clutch master cylinder push rod attachment.

If the condition exists, remove the plastic bushing from the master cylinder push rod and replace with the following service parts. (Refer to Figure 1):

<b>DESCRIPTION</b>	<b>PART NUMBER</b>
Bushing	14080233
Flat Washer	120395
Retainer	148149

Use applicable Labor Time and Operation Number.

Chevrolet Motor Division  
General Motors Corporation

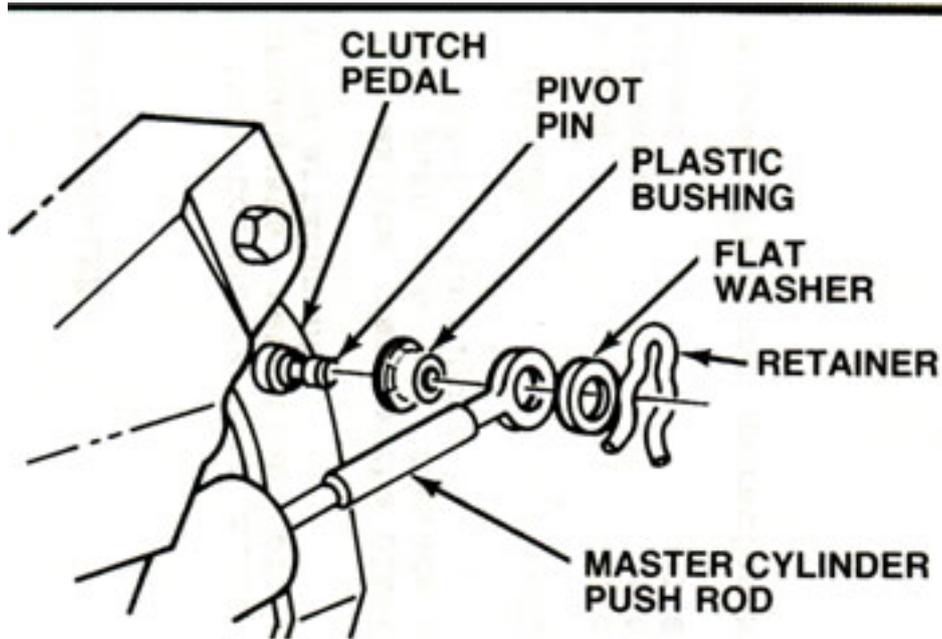

Online URL:

<https://www.corvetteactioncenter.com/tech/knowledgebase/article/1986-1987-corvette-service-bulletin-clutch-master-cylinder-push-rod-bushing-904.html>